

Diagnosis report of 2015 OPEL MOKKA T Cosmo



Car details

Color: Grey	CO ₂ NEDC Emission: 139 g/km
Fuel type: Petrol	
Body type: SUV	Gross Vehicle Weight (GVW): 1828 kg
Number of doors: 5	Engine size: 1.40 l
Number of seats: 5	Cylinders: 4
Mileage: 165 713 km	Power: 103 kw
VIN Code: W0LJD7E88FB104148	Fuel consumption: 6.00 l/100km
Gearbox: Manual	Tire size: 215/60 - 17"
Drive type: Front-Wheel Drive	Longo Stock ID: N041150
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of 2015 OPEL MOKKA T Cosmo



Diagnosis details

Mileage on completion date: 165 713 km

Checked by Longo Shared Service certified diagnostics team: Mindaugas G., Eimantas A., Arnas S.


This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues

During the comprehensive diagnosis conducted by Longo, 22 issues were identified in the vehicle.

Interior	Exterior	Mechanical
✔ 7 issues identified	✔ 2 issues identified	✔ 13 issues identified

Diagnosis process

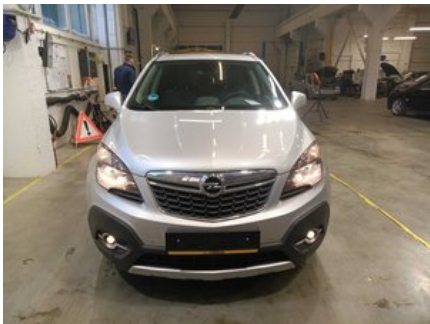

Interior

- ✔ 1. Operation: Air-Conditioning System - Functioning

✓ **2. Inside:** Accessories - Functioning and Condition



✓ **3. Inside:** Accessories - Functioning and Condition



✓ **4. Inside:** Accessories - Functioning and Condition



✓ **5. Inside:** Accessories - Functioning and Condition



✓ **6. Inside:** Accessories - Functioning and Condition



✓ **7. Front:** Dashboard - Condition and Button Operation



Exterior

- ✓ **1. Rear:** Rear Bumper - Condition and Alignment



- ✓ **2. Front:** Windscreen Integrity - Free from MOT-Excluding Damage



Mechanical

- ✓ **1. OTHER:** Engine Oil & Filter Change
- ✓ **2. OTHER:** Charge Battery



✓ **3. OTHER:** Change Tires



✓ **4. ENGINE:** Camshaft Valve Cover & Gasket



✓ **5. ENGINE:** Camshaft Drive Chain




✓ **6. BRAKES:** Wheel Sensor - Rear (One)




✓ **7. BRAKES:** Rear Brake Disc (Both)



✓ **8. BRAKES:** Front Brake Discs Both

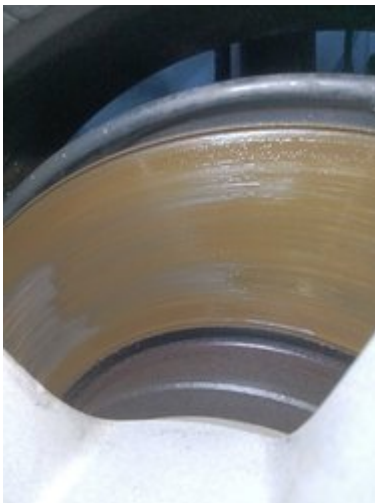

✓ **9. ENGINE MANAGEMENT - FUEL:** Throttle Position

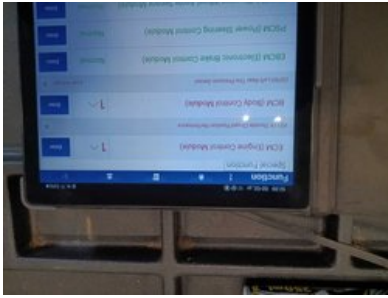

✓ **10. AUTOMATIC TRANSMISSION:** Oil Cooler



✓ **11. COOLING SYSTEM:** Header/Expansion Tank



✓ **12. SUSPENSION:** Strut Top Mounting (Both)





Other



✓ 3. Air-Conditioning Measurement



✓ 4. Add Photo of Front Interior



Preparation and repair report of 2015 OPEL MOKKA T Cosmo



Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Mechanical repairs

- ✓ 1. Charge Battery
- ✓ 2. Compressor Clutch
- ✓ 3. Throttle Position
- ✓ 4. Oil Cooler
- ✓ 5. Change Tires
- ✓ 6. Strut Top Mounting (Both)
- ✓ 7. Engine Oil & Filter Change
- ✓ 8. Wheel Sensor - Rear (One)
- ✓ 9. Camshaft/Valve Cover & Gasket
- ✓ 10. Header/Expansion Tank

Cleaning & polishing

- ✓ 1. Body wet wash
- ✓ 2. Full interior deep clean using only hypoallergenic cleaning products
- ✓ 3. Post cleaning body polish

Spare parts used during preparation

- 1. Engine Oil 4L
- 2. Oil Filter (OE648/6)
- 3. Tire MAXTREK 215/60R17 96T TREK M8 C D 72 (MXT00339)
- 4. Oil Cooler Seal (EL876570)
- 5. Crankshaft Seal (EL127610)
- 6. Water Pump Gasket (EL744570)
- 7. Rocker Cover Gasket (71-40674-00)
- 8. Oil Cooler Gasket (55568540)
- 9. Top Strut Mounting (KYBSM1008)
- 10. Oil Seal Gasket (476.750)
- 11. Header/Expansion Tank (NRF454156)
- 12. Throttle Valve (GTV557)
- 13. AC Clutch Magnet (NRF38575)
- 14. Axle Speed Sensor, Rear Right (ADG07196)

Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.


Additional information about **2015 OPEL MOKKA T Cosmo**



Additional pictures





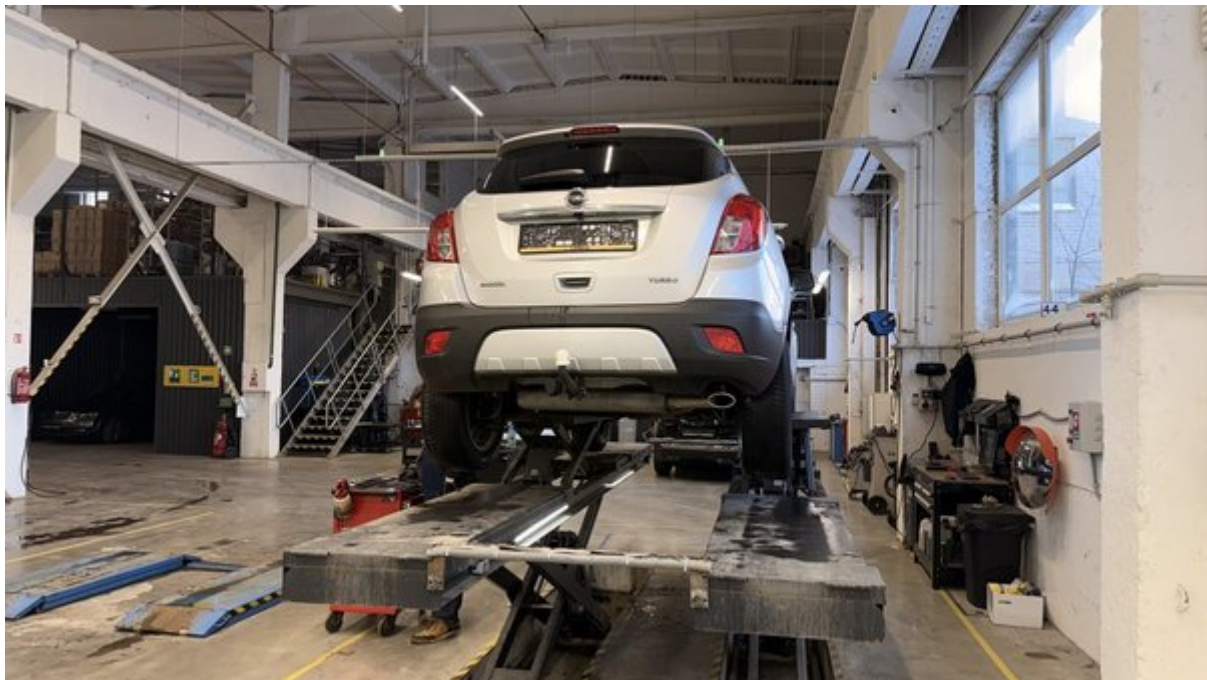









Bevestiging onderhoud		5
Bevestiging onderhoud Op de volgende pagina's worden de uitgevoerde onderhoudswerkzaamheden geregistreerd. Voer onderhoud uit, wanneer het service-display dat aangeeft, maar niet later dan de vermelde onderhoudsintervallen in de gebruikershandleiding. Betrouwbare motoroliekwaliteiten en motorolieviscositeiten vindt u in de gebruikershandleiding.		
Deze werkzaamheden moeten met ja of nee worden aangekruist Ja = is vervast of vervangen Nee = geen vervanging nodig Opmerking Vastgelegde gegevens mogen niet worden gewijzigd.		
Onderhoud : Klein ☒ Groot ☐ Datum <u>01-02-17</u> km <u>29794</u> Motorolie Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐ Motorolieviscositeit: <u>5W-30</u> Vorstbescherming, koelvloeistof <u>-25 °C</u> Ja Nee ☒ ☒ Batterij (handzender) ☒ ☒ Pollenfilter ☒ ☒ Luchtfilterelement ☒ ☒ Poly-V-riem ☒ ☒ Tandriem ☒ ☒ Brandstoffilter ☒ ☒ Transmissieolie ☒ ☒ Remvloeistof ☒ ☒ Bandenreparatieset ☒ ☒ Remvoeringen voor/achter ☒ ☒ Bougies ☒ ☒ Koelvloeistof		VAN KOUWEN Snijdersbergweg 99-101 1105 AN Amsterdam Tel: 020-650 0670 Fax: 020-650 0671 www.vankouwen.nl

6 Bevestiging onderhoud		Bevestiging onderhoud		Bevestiging onderhoud	
Onderhoud : Klein ☐ Groot ☐ Datum <u>01-02-17</u> km <u>29794</u> Motorolie Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐ Motorolieviscositeit: <u>5W-30</u> Vorstbescherming, koelvloeistof <u>-25 °C</u> Ja Nee ☒ ☒ Batterij (handzender) ☒ ☒ Pollenfilter ☒ ☒ Luchtfilterelement ☒ ☒ Poly-V-riem ☒ ☒ Tandriem ☒ ☒ Brandstoffilter ☒ ☒ Transmissieolie ☒ ☒ Remvloeistof ☒ ☒ Bandenreparatieset ☒ ☒ Remvoeringen voor/achter ☒ ☒ Bougies ☒ ☒ Koelvloeistof		Onderhoud : Klein ☒ Groot ☐ Datum <u>2-2-18</u> km <u>46591</u> Motorolie Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐ Motorolieviscositeit: <u>5W-30</u> Vorstbescherming, koelvloeistof <u>-25 °C</u> Ja Nee ☒ ☒ Batterij (handzender) ☒ ☒ Pollenfilter ☒ ☒ Luchtfilterelement ☒ ☒ Poly-V-riem ☒ ☒ Tandriem ☒ ☒ Brandstoffilter ☒ ☒ Transmissieolie ☒ ☒ Remvloeistof ☒ ☒ Bandenreparatieset ☒ ☒ Remvoeringen voor/achter ☒ ☒ Bougies ☒ ☒ Koelvloeistof		Onderhoud : Klein ☐ Groot ☐ Datum <u>04-06-18</u> km <u>54064</u> Motorolie Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐ Motorolieviscositeit: <u>W-</u> Vorstbescherming, koelvloeistof <u>-25 °C</u> Ja Nee ☒ ☒ Batterij (handzender) ☒ ☒ Pollenfilter ☒ ☒ Luchtfilterelement ☒ ☒ Poly-V-riem ☒ ☒ Tandriem ☒ ☒ Brandstoffilter ☒ ☒ Transmissieolie ☒ ☒ Remvloeistof ☒ ☒ Bandenreparatieset ☒ ☒ Remvoeringen voor/achter ☒ ☒ Bougies ☒ ☒ Koelvloeistof	
VAN KOUWEN Snijdersbergweg 99-101 1105 AN Amsterdam Zuidoost Tel: 020-650 0670 Fax: 020-650 0671 www.vankouwen.nl		VAN KOUWEN Snijdersbergweg 99-101 1105 AN Amsterdam Tel: 020-650 0670 Fax: 020-650 0671 www.vankouwen.nl		Automobilbedrijf van Yperen Constructieweg 2 3641 SB MIJDRECHT Tel: 0297 - 28 46 10	

8 Bevestiging onderhoud		8 Bevestiging onderhoud		8 Bevestiging onderhoud	
Onderhoud : Klein ☒ Groot ☐	Datum 13-2-2015 115820	Onderhoud : Klein ☐ Groot ☒	Datum 23-2-2015 133900	Onderhoud : Klein ☒ Groot ☐	Datum 31-01-2015 150395
Motorolie	Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐	Motorolie	Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐	Motorolie	Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐
Motorolieviscositeit: W-	Vorstbescherming, koelvloeistof °C	Motorolieviscositeit: W-	Vorstbescherming, koelvloeistof °C	Motorolieviscositeit: 5 W-30	Vorstbescherming, koelvloeistof °C
Ja Nee	Accu V.V.	Ja Nee		Ja Nee	
☒ Batterij (handzender)		☒ Batterij (handzender)		☒ Batterij (handzender)	
☒ Pollenfilter		☒ Pollenfilter		☒ Pollenfilter	
☐ Luchtfilterelement		☐ Luchtfilterelement		☐ Luchtfilterelement	
☐ Poly-V-riem		☐ Poly-V-riem		☐ Poly-V-riem	
☐ Tandriem		☐ Tandriem		☐ Tandriem	
☐ Brandstoffilter		☐ Brandstoffilter		☐ Brandstoffilter	
☐ Transmissieolie		☐ Transmissieolie		☐ Transmissieolie	
☐ Remvloeistof		☐ Remvloeistof		☐ Remvloeistof	
☐ Bandenreparatieset		☐ Bandenreparatieset		☐ Bandenreparatieset	
☐ Remvoering van voorlichter		☐ Remvoering van voorlichter		☐ Remvoering van voorlichter	
☐ Bougies		☐ Bougies		☐ Bougies	
Gerdina's Hof 33, 4191 MX Geldermalsen 0345-820300 info@jilissautobedrijven.nl SERVICE DIE BIJBLIJFT		Gerdina's Hof 33, 4191 MX Geldermalsen 0345-820300 info@jilissautobedrijven.nl SERVICE DIE BIJBLIJFT		Gerdina's Hof 33, 4191 MX Geldermalsen 0345-820300 info@jilissautobedrijven.nl SERVICE DIE BIJBLIJFT	

7 Bevestiging onderhoud		7 Bevestiging onderhoud		7 Bevestiging onderhoud	
Groot ☐	Datum 14-2-2015 76731	Groot ☒	Datum 5-2-2015 84500	Groot ☒	Datum 11-2-2015 90775
Motorolie	Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐	Motorolie	Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐	Motorolie	Kwaliteit : dexos 1 ☐ dexos 2 ☐ GM-LL-A-025 ☐ GM-LL-B-025 ☐ ACEA A3 ☐ B4 ☐ C3 ☐
Motorolieviscositeit: 5 W-20	Vorstbescherming, koelvloeistof °C	Motorolieviscositeit: 5 W-30	Vorstbescherming, koelvloeistof °C	Motorolieviscositeit: 5 W-20	Vorstbescherming, koelvloeistof °C
Ja Nee		Ja Nee		Ja Nee	
☒ Batterij (handzender)		☒ Batterij (handzender)		☒ Batterij (handzender)	
☒ Pollenfilter		☒ Pollenfilter		☒ Pollenfilter	
☒ Luchtfilterelement		☒ Luchtfilterelement		☒ Luchtfilterelement	
☐ Poly-V-riem		☐ Poly-V-riem		☐ Poly-V-riem	
☐ Tandriem		☐ Tandriem		☐ Tandriem	
☐ Brandstoffilter		☐ Brandstoffilter		☐ Brandstoffilter	
☐ Transmissieolie		☐ Transmissieolie		☐ Transmissieolie	
☐ Remvloeistof		☐ Remvloeistof		☐ Remvloeistof	
☐ Bandenreparatieset		☐ Bandenreparatieset		☐ Bandenreparatieset	
☐ Remvoering van voorlichter		☐ Remvoering van voorlichter		☐ Remvoering van voorlichter	
☐ Bougies		☐ Bougies		☐ Bougies	
Gerdina's Hof 33, 4191 MX Geldermalsen 0345-820300 info@jilissautobedrijven.nl SERVICE DIE BIJBLIJFT		Gerdina's Hof 33, 4191 MX Geldermalsen 0345-820300 info@jilissautobedrijven.nl SERVICE DIE BIJBLIJFT		Gerdina's Hof 33, 4191 MX Geldermalsen 0345-820300 info@jilissautobedrijven.nl SERVICE DIE BIJBLIJFT	









Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be included or omitted.



Vehicle Identity & History

Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked

Exterior Condition

Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected

Interior Condition

Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked

Lights, Mirrors & Glass

Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		

Comfort & Electronics

Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	

Safety Equipment

Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)

Engine Bay & Fluids

Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	

Braking System

Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	

Steering & Suspension

Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		

Wheels & Tyres

Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		

Exhaust & Fuel System

Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		

Road Test & Driving Performance

Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	