

Diagnosis report of 2015 VOLVO V60 Momentum



Car details

Color: Black	CO ₂ NEDC Emission: 48 g/km
Fuel type: Diesel / Hybrid / Plug-in	
Body type: Wagon	Gross Vehicle Weight (GVW): 2505 kg
Number of doors: 5	Engine size: 2.40 l
Number of seats: 5	Cylinders: 5
Mileage: 259 593 km	Power: 212 kw
VIN Code: YV1GWDCH0G1313485	Fuel consumption: 1.80 l/100km
Gearbox: Automatic	Tire size: 235/40 - 19"
Drive type: All-Wheel Drive	Longo Stock ID: N156360
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of 2015 VOLVO V60 Momentum



Diagnosis details

Mileage on completion date: 259 593 km

Checked by Longo Shared Service certified diagnostics team: Eimantas A., Arnas S.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues



During the comprehensive diagnosis conducted by Longo, 14 issues were identified in the vehicle.

Interior	Exterior	Mechanical
✔ 1 issues identified	✔ 9 issues identified	✔ 4 issues identified

Diagnosis process



OBD II diagnosis

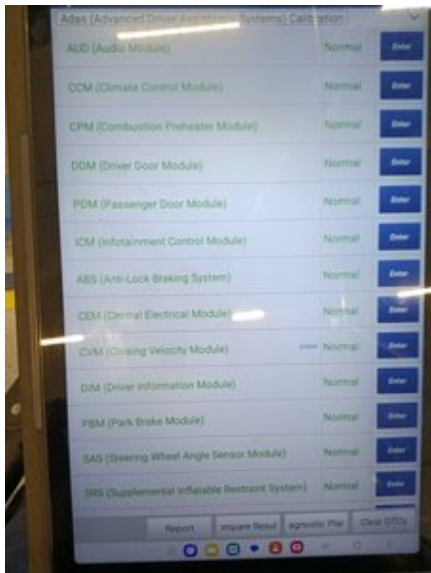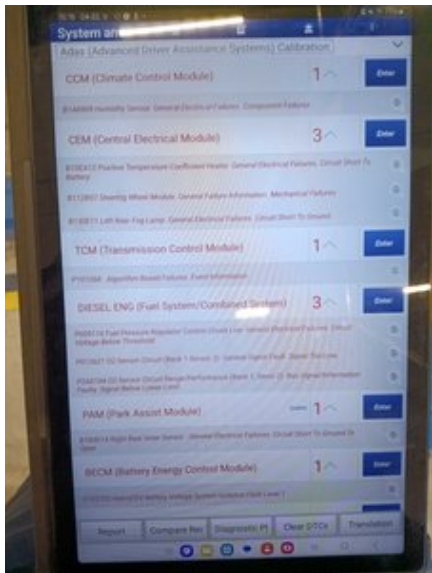

Interior

✔ 1. Front: Steering Wheel - Condition



Exterior

✔ 1. Lights: Front Lights (City, Regular, Full Headlight, Fog, Indicator) - Basic Functioning, Damage, and Color



✔ 2. Side: Left and Right Side - Visual Damage and Scratches



✔ 3. Side: Left and Right Side - Visual Damage and Scratches



✓ **4. Side:** Left and Right Side - Visual Damage and Scratches



✓ **5. Side:** Left and Right Side - Visual Damage and Scratches



✓ **6. Side:** Wheels - Condition



✓ **7. Rear:** Rear Bumper - Condition and Alignment



✓ **8. Front:** Front Bumper - Condition and Alignment



✓ **9. Front:** Front Bumper - Condition and Alignment



Mechanical

✓ **1. OTHER:**

✓ **2. OTHER:**



✓ **3. OTHER:** Rear Brake Discs Including Pads



✓ 4. OTHER:



Other

✓ 1. Diagnostic Photo



✓ 2. Brake Test Line Results



✓ 3. Add Photo of Front Interior



✓ 4. Air-Conditioning Measurement



Preparation and repair report of 2015 VOLVO V60 Momentum



Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Body & Interior

- ✓ 1. Change Headlights

Mechanical repairs

- ✓ 1. Engine Oil and Filter
- ✓ 2. Rear Brake Discs Including Pads

Paintshop

- ✓ 1. Paint Front Fender
- ✓ 2. Paint Front Bumper

Cleaning & polishing

- ✓ 1. Body wet wash
- ✓ 2. Full interior deep clean using only hypoallergenic cleaning products
- ✓ 3. Post cleaning body polish

Spare parts used during preparation

- 1. Oil Filter (OE662/3)
- 2. Total Ineo First 0W30 208L (0w30 TOTAL 208L)
- 3. Brake Disc (0986479398)
- 4. Brake Pads Kit (0986494213)
- 5. Oil Pan Gasket (EL247804)
- 6. Headlight Left V60 31420115 (DMR50162)

Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Additional information about **2015 VOLVO V60 Momentum**



Additional pictures

















SERVICE EN ONDERHOUD	
Servicebeurt nr. 9 Kilometerstand: <u>218569</u> Datum: <u>22/03/2024</u> Werkorder nr.: <u>-</u> Soort servicebeurt: Reguliere service: Kwik-Fit 344 Alzomweg 13B 9743 AJ GRONINGEN 050-3112807 Extra vervanging-/vervangingsbeurt olie/filt.: <u>APK + KB</u> <u>BZ</u> Opmerking: STEMPEL	Servicebeurt nr. 10 Kilometerstand: <u>244048</u> Datum: <u>3 juni 2025</u> Werkorder nr.: Soort servicebeurt: Reguliere service: kleine beurt Voor schijven en blokken vervangen. Extra vervanging-/vervangingsbeurt olie/filt.: <u>olie filter vervangen.</u> STEMPEL GARAGE BOSSCHA Opmerking: Vrijvreespecialist sinds 1955 Voor onderhoud en reparatie Looptswaag www.garagebos.nl +31(0)
Servicebeurt nr. 11 Kilometerstand: Datum: Werkorder nr.: Soort servicebeurt: Reguliere service: STEMPEL Extra vervanging-/vervangingsbeurt olie/filt.: STEMPEL Opmerking: STEMPEL	Servicebeurt Kilometerstand: Datum: Werkorder nr.: Soort servicebeurt: Reguliere service: STEMPEL Extra vervanging-/vervangingsbeurt olie/filt.: STEMPEL Opmerking: STEMPEL

SERVICE EN ONDERHOUD

Servicebeurt nr. 6	Servicebeurt nr. 7	Servicebeurt nr. 8
Kilometerstand: 155459	Kilometerstand: 185981	Kilometerstand: 205438
Datum: 10-2-22	Datum: 15/2/23	Datum: 11/3/23
Werkorder nr.: 3413P	Werkorder nr.: 38585	Werkorder nr.: 41078
Soort servicebeurt:	Soort servicebeurt:	Soort servicebeurt:
VAKGARAGE VELDMA JANSEN Wadwerd 2 9746 DC Groningen Tel. 050-5719900 www.vakgarageveldmajansen.nl	VAKGARAGE VELDMA JANSEN Wadwerd 2 9746 DC Groningen Tel. 050-5719900 www.vakgarageveldmajansen.nl	VAKGARAGE VELDMA JANSEN Wadwerd 2 9746 DC Groningen Tel. 050-5719900 www.vakgarageveldmajansen.nl
Extra verversings-/vervangingsbeurt olie/filt.: Gr.beurt. v. branden w.v.	Extra verversings-/vervangingsbeurt olie/filt.: GR. Beurt Rem.VL. A.C.	Extra verversings-/vervangingsbeurt olie/filt.: Distri.Bulke + w. Rom? Verlonge
Opmerking: STEMPEL	Opmerking: STEMPEL	Opmerking: STEMPEL

»

SERVICE EN ONDERHOUD

Servicebewijs

Zorg dat de formulieren na iedere onderhoudsbeurt worden afgestempeld en getekend door uw Volvo-dealer of Volvo Erkend Hersteller.

De Volvo-dealer kan u informeren over de inhoud van Volvo Original Service voor uw auto.

Vergeet niet onderhoud te verrichten volgens de onderhoudsintervallen.

Servicebeurt nr. 1	Servicebeurt nr. 2
Kilometerstand: 27391	Kilometerstand:
Datum: 17-2-17	Datum: 11-1-2018
Werkorder nr.: 232667	Werkorder nr.: 9812827
Soort servicebeurt:	Soort servicebeurt:
Regular service Svala Auto Lijnden Postbus 204 2100 AE Heemstede 023-5648222 info.lijnden@svalaauto.nl	Regular service VERKERK VOLVO Meijewetering 41 3543 AA Utrecht tel. 030-2411440
Extra verversings-/vervangingsbeurt olie/filt.: STEMPEL	Extra verversings-/vervangingsbeurt olie/filt.: STEMPEL
Opmerking: STEMPEL	Opmerking:  STEMPEL

»

SERVICE EN ONDERHOUD

Servicebeurt nr. 3

Kilometerstand: **88741**

Datum: **24-1-19**

Werkorder nr.: **243940**

Soort servicebeurt:

Reguliere service:

Svala Auto Lijnden
Postbus 204
2100 AE Heemstede
023-5648222
info.lijnden@svalaauto.nl

Extra vervangings-/vervangingsbeurt olie/filt.:
M.riem oer

Opmerking:

Servicebeurt nr. 4

Kilometerstand: **120750**

Datum: **7-4-2020**

Werkorder nr.:

Soort servicebeurt:

Reguliere service:

Vaartland.nl Heerenveen
Chroomweg 4
8445 PN Heerenveen
0513-636516

Extra vervangings-/vervangingsbeurt olie/filt.:
remblokken V+A w

Opmerking:

Servicebeurt nr. 5

Kilometerstand: **141262**

Datum: **9-3-2021**

Werkorder nr.:

Soort servicebeurt:

VAKGARAGE VELDMA JANS
Friesestraatweg 231
9743 AE Groningen
Tel. 050-5719900
www.vakgarageveldma.nl

Extra vervangings-/vervangingsbeurt olie/filt.:
Remul

Opmerking:





Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be included or omitted.



Vehicle Identity & History

Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked

Exterior Condition

Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected

Interior Condition

Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked

Lights, Mirrors & Glass

Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		

Comfort & Electronics

Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	

Safety Equipment

Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)

Engine Bay & Fluids

Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	

Braking System

Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	

Steering & Suspension

Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		

Wheels & Tyres

Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		

Exhaust & Fuel System

Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		

Road Test & Driving Performance

Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	