Diagnosis report of
2014 NISSAN QASHQAI Tekna

Car details

Color: Blue	CO_2 NEDC Emission: 129 g/km
Fuel type: Petrol	
Body type: SUV	Gross Vehicle Weight (GVW): 1860 kg
Number of doors: 5	Engine size: 1.20 l
Number of seats: 5	Cylinders: 4
Mileage: 184 817 km	Power: 85 kw
VIN Code: SJNFEAJ11U1262297	Fuel consumption: 5.60 l/100km
Gearbox: Manual	Tire size: 225/45 - 19"
Drive type: Front-Wheel Drive	Longo Stock ID: N567164
Longo Certified	

Car photos



Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.

Diagnosis report of
2014 NISSAN QASHQAI Tekna

Diagnosis details

Mileage on completion date: 184 817 km

Checked by Longo Shared Service certified diagnostics team: Eimantas A., Arnas S., Mindaugas G.

This vehicle has been inspected in accordance with the Longo 150-point checklist, covering the body exterior, interior, and mechanical condition. Based on the inspection performed and the information available at the time of assessment, no indications of involvement in major accidents were identified. Information regarding maintenance history and mandatory roadworthiness inspections is based on available documentation and records from the country of export. Please note that certain general wear and tear issues are considered acceptable and may not be repaired.

Summary of diagnosed issues

During the comprehensive diagnosis conducted by Longo, 13 issues were identified in the vehicle.


Interior	Exterior	Mechanical
3 issues identified	3 issues identified	7 issues identified

Diagnosis process





OBD II diagnosis

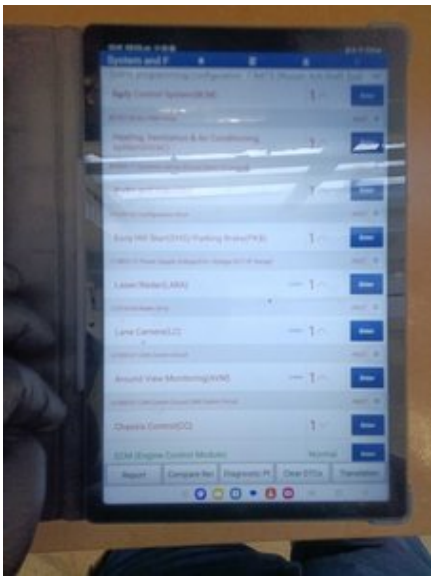


Interior

1. Inside: Gear Shift Boot and Gear Shift Knob - Condition



2. Front: Window Wiper Rubber and Handle (Front and Rear) - Condition



3. Front: Window Wiper Rubber and Handle (Front and Rear) - Condition



Exterior

1. Side: Wheels - Condition






2. Front: Hood Opening and Holding Mechanism




3. Other: Roof - Visual Damage (e.g., Hail Damage)



Mechanical

1. OTHER: Engine Oil & Filter Change

2. OTHER: Charge Battery

3. ENGINE: Camshaft Valve Cover & Gasket



4. SUSPENSION: Strut Top Mounting (Both)



5. STEERING: Front Wheel Alignment (Toe)

6. STEERING: Track Rod End Joint


7. BRAKES: Front Brake Discs Both



Other

1. Diagnostic Photo

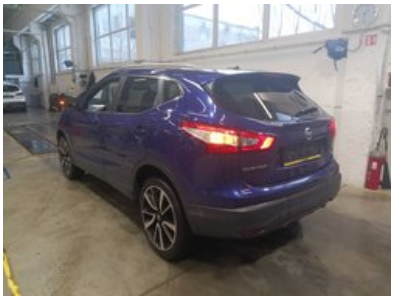

2. Brake Test Line Results





3. Air-Conditioning Measurement



4. Add Photo of Front Interior



Preparation and repair report of
2014 NISSAN QASHQAI Tekna

Summary of work performed in Longo Preparation center

During the preparation process, the following works were performed

Body & Interior

- 1. Change Hood Holding Mechanism

Mechanical repairs

- 1. Change Front Wiper (Mechanical)
- 2. Change Rear Wiper (Mechanical)
- 3. Charge Battery
- 4. Engine Oil & Filter Change
- 5. Camshaft/Valve Cover & Gasket
- 6. Track Rod End Joint
- 7. Front Wheel Alignment (Toe)

Cleaning & polishing

- 1. Body wet wash
- 2. Full interior deep clean using only hypoallergenic cleaning products
- 3. Post cleaning body polish

Spare parts used during preparation

1. Engine Oil 4.6L
2. Oil Filter (OE666/3)
3. Cylinder Head Cover Gasket (599.170)
4. Bonnet Clip (65773CY00B)
5. Wiper (VAL575833)
6. Wiper (VAL575826)
7. Oil Drain Plug Seal (813.052)
8. Rear Wiper (SWF116520)
9. Tie Rod End (840136410)

Disclaimer

This report has been generated automatically using the information available in our systems and may not be fully comprehensive or complete. Automated translation technology was used in its preparation, and as a result, minor inaccuracies may occur. If you have any questions or if any part of the report is unclear, please do not hesitate to contact our sales team. They will be happy to assist you.


Additional information about
2014 NISSAN QASHQAI Tekna

Additional pictures






ALL SEASON MASTER
MINERVA

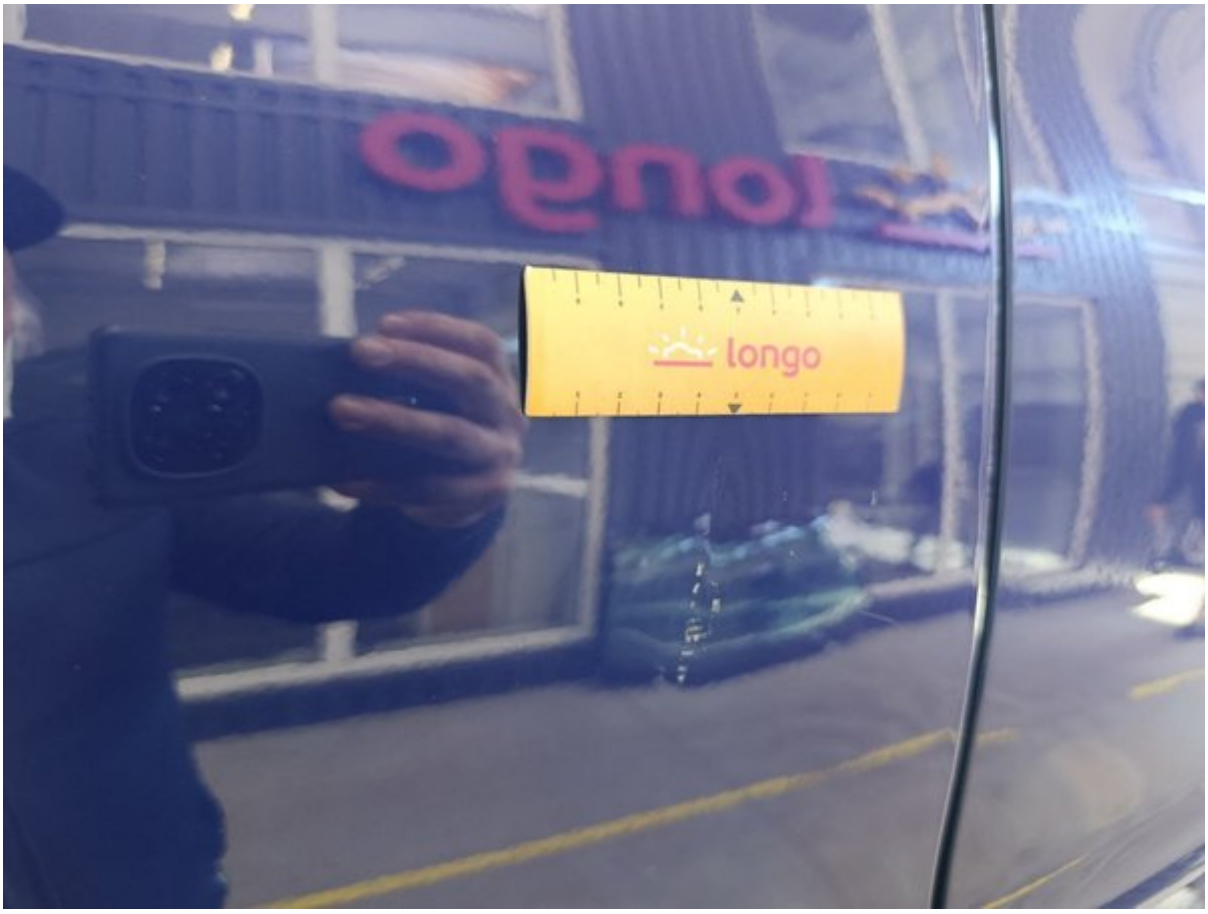

longo




longo





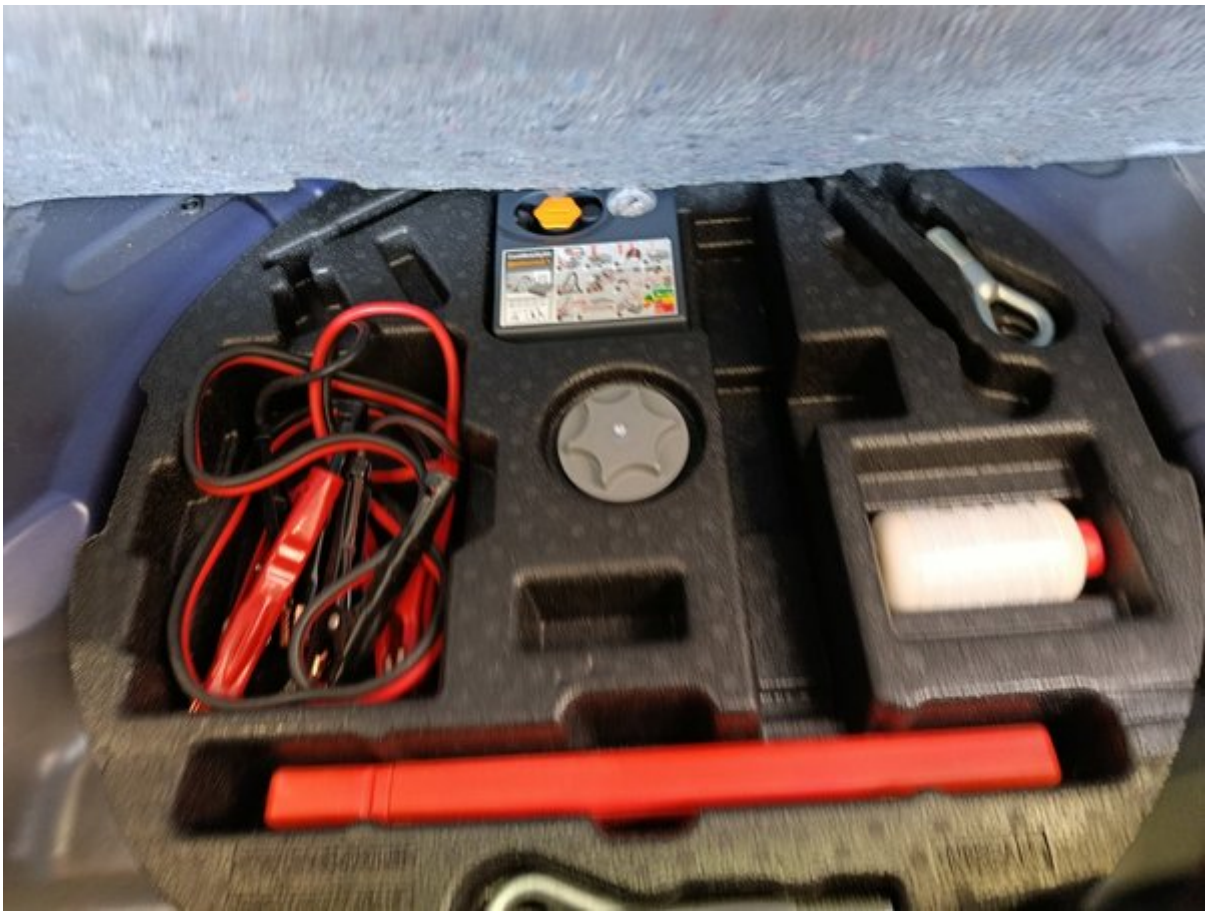



Veiligheidstas
NISSAN
PULSAR


NISSAN
e11*2007/46*0963
SJNFEAJ11U1262297
1860 kg
3060 kg
1– 965 kg
2– 970 kg
Type FEAJ11 Colour, Trim RBN G
Model FRLALCYJ11UGAM – CBN


11:48
17°c
Driving Aids
Enter = Settings
193
184818km


GOLD FM
11:49
1
2
3
4
5
6
Menu
50 m


11:49
17°c
Driving Aids
Enter = Setting
193
184818km

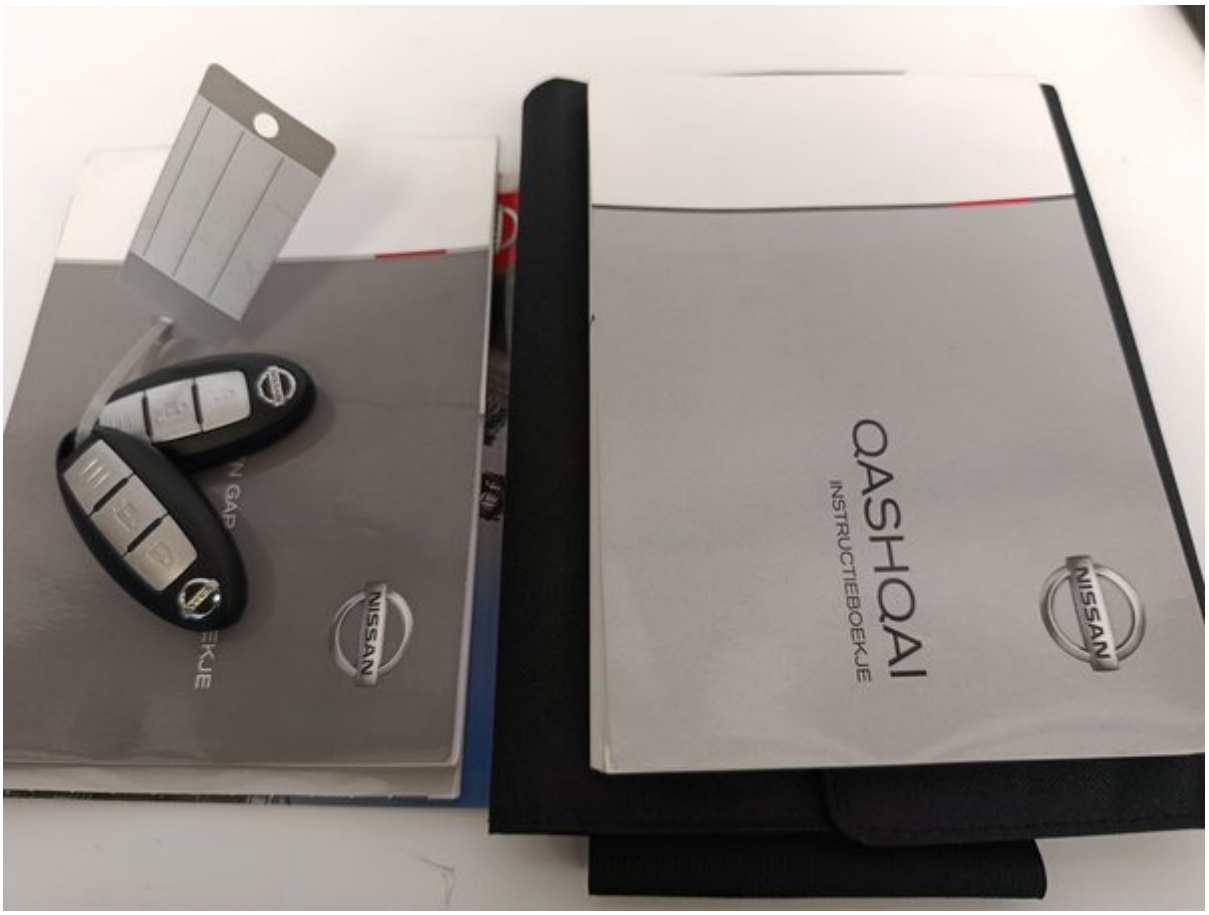
QASHQAI
INSTRUCTIEBOEKJE
NISSAN


TotalEnergies
Oil: 5W30
Mileage: 184817
Date: 2026 03-18
Oil Filter Change:
Next Oil Change
Mileage: 194 817
Date: 2028 03-18
Service Technician Signature:
totalenergies.pl





Longo 150-point checklist

Every vehicle is carefully examined according to Longo's comprehensive 150-point checklist, ensuring a thorough assessment mechanical condition. Depending on the factors such as condition, mileage, and specifications, additional checks may be includ may be omitted.

Vehicle Identity & History		
Vehicle identification number (VIN) verified	Registration number confirmed	Mileage verified
Year of manufacture confirmed	First registration date confirmed	Service history checked
Last service date and mileage recorded	Next service due date recorded	Previous accident damage check performed
Manufacturer recall status checked	Vehicle documents verified	Number of keys checked
Exterior Condition		
Front bumper inspected	Rear bumper inspected	Bonnet/hood inspected
Roof inspected	Left side panels inspected	Right side panels inspected
All doors inspected	Boot/trunk inspected	Fuel filler cover inspected
Tow bar (if fitted) inspected	Number plate condition confirmed	Paintwork overall checked
Rust or corrosion checked	Gaps between panels checked	Windscreen inspected
Rear window inspected	Side windows inspected	Sunroof/panoramic roof inspected
Interior Condition		
Driver's seat condition checked	Passenger seats checked	Rear seats checked
Seat adjustment mechanisms tested	Seat heating/cooling tested (if fitted)	Seatbelts checked
Carpets inspected	Floor mats inspected	Headlining inspected
Interior trims inspected	Dashboard inspected	Door trims inspected
Armrest inspected	Parcel shelf inspected	Luggage area condition checked
Luggage area carpets checked	Luggage area lighting tested	Spare wheel / repair kit checked
Lights, Mirrors & Glass		
Front headlights tested	High beam tested	Fog lights tested
Daytime running lights tested	Rear lights tested	Brake lights tested
Reverse lights tested	Indicators tested	Number plate lights tested
Side markers/reflex reflectors checked	Interior lights tested	Dashboard warning lights checked
Sun visors inspected	Interior mirror inspected	Exterior mirrors inspected
Electric mirror adjustment tested		
Comfort & Electronics		
Air conditioning tested	Heating system tested	Ventilation system tested
Window heating tested (front/rear)	Power windows tested	Central locking tested
Remote key tested	Child lock tested	Infotainment screen tested
Radio tested	Navigation tested (if fitted)	Bluetooth connection tested
USB/12V sockets tested	Parking sensors tested	Rear view camera tested
Parking assistance systems tested	Cruise control tested	Steering wheel buttons tested
Horn tested	Electronic driver aids checked (lane assist, etc., if fitted)	
Safety Equipment		
Airbags checked via system	Passenger airbag switch checked	ABS warning light checked
ESC/traction control checked	Tyre pressure monitoring system tested	Fire extinguisher/first aid kit present (if supplied)
Engine Bay & Fluids		
Engine starts normally	Engine idles smoothly	Unusual engine noises checked
Engine mounts checked	Drive belts checked	Timing belt/chain condition checked
Battery condition tested	Battery charging tested	Alternator performance tested
Fluid leaks checked	Engine oil level checked	Engine oil quality checked
Coolant level checked	Coolant quality checked	Brake fluid level checked
Brake fluid quality tested	Power steering fluid level checked	Power steering fluid quality checked
Windscreen washer fluid filled	Fuel system checked for leaks	
Braking System		
Front brake discs checked	Rear brake discs checked	Brake pads checked
Brake hoses checked	Brake lines checked	Parking brake tested
Brake pedal response tested	ABS function confirmed	
Steering & Suspension		
Steering wheel alignment checked	Steering response tested	No excessive steering play confirmed
Power steering assistance tested	Front suspension inspected	Rear suspension inspected
Shock absorbers inspected	Springs inspected	Ball joints inspected
Wheel bearings checked		
Wheels & Tyres		
Front tyres tread depth measured	Rear tyres tread depth measured	Tyre wear pattern checked
Tyre sidewalls inspected	Tyre pressures checked	Spare tyre condition checked
Alloy wheels checked for damage	Wheel nuts/bolts secure	Locking wheel nut present
Additional tyre set inspected (if included)		
Exhaust & Fuel System		
Exhaust condition checked	Exhaust leaks checked	Catalytic converter present
Diesel particulate filter present (if fitted)	Fuel tank condition checked	Fuel lines inspected
Fuel filler cap tested		
Road Test & Driving Performance		
Smooth acceleration confirmed	Smooth gear shifting confirmed	Clutch operation tested
Braking performance tested	Driving stability confirmed	